

OL100342**FIBER OPTIC SENSORS • FIBER OPTIC AMPLIFIERS**

Fiber optics in combination with the appropriate fiber optic amplifier function as contactless and wear-free position switches that can also be used in harsh environmental conditions. They detect objects independent of their characteristics (e.g., shape, color, surface structure, material). Because the ends and heads of the fiber optics have small dimensions and the fiber optics are flexible, very elegant solutions can be created for detecting objects in places that are difficult to access. Fiber optics can be used without special precautions in potentially explosive areas and in zones with electrical and/or magnetic fields (high-voltage installations, electrical welding equipment) as their function is not thereby affected. Fiber optics are available in versions for implementing the function as through-beam sensor or diffuse reflection sensor.

**MECHANICAL DATA**

Ambient temperature (MAX)	55 °C
Ambient temperature (MIN)	-25 °C
Amplifier height	30.5 mm
Amplifier length	70 mm
Amplifier width	10 mm
Degree of protection (IP)	IP40
Housing design	Cuboid
Housing material	ABS

ELECTRICAL DATA

Analogue output 4 mA ... 20 mA	No
Connection amplifier with interference suppression	Yes
Hysteresis	10 %
Max. output current	100 mA
No-load current	40 mA
Operating voltage (MAX)	24 V
Operating voltage (MIN)	12 V
Response/decay time	2 ms
Reverse polarity protection	Yes
Scanning function	Light-/dark-on mode
Setting procedure	Teach-In
Setting via teach-in	Yes
Short-circuit-proof	Yes
Switching frequency	7000 Hz
Time function	Yes
Type of electrical connection	Plug-in connection
Type of switching output	PNP
Voltage drop	1.5 V
Voltage type	DC

ELECTRICAL DATA

With LED display

Yes

OPTICAL DATA


Light source

Green light

Wavelength of the sensor

520 nm

CONNECTION

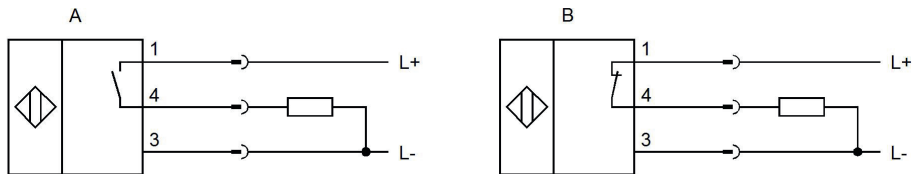


Colors: A: 1 = BN (brown), 3 = BU (blue), 4 = BK (black)

B: 1 = BN (brown), 3 = BU (blue), 4 = BK (black) **Functions:** A: 1 = L+, 3 = L-, 4 = PNP NO

B: 1 = L+, 3 = L-, 4 = PNP NC

DIMENSIONAL DRAWING

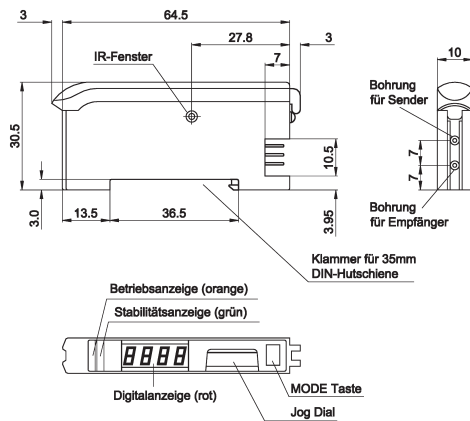

INSTALLATION



Mounting / Installation may only be carried out by a qualified electrician!

DISPOSAL



SAFETY WARNINGS

Before initial operation, please make sure to follow all safety instructions that may be provided in the product information!

Never use these devices in applications where the safety of a person depends on their functionality.